RETURN TO SERVICE PROCEDURE TABLE OF CONTENTS
RETURN TO CD-ROM TABLE OF CONTENTS

DrägerService®

Dräger

Field Service Procedure

Part Number: SP00194
Rev: A
Date: 9 June 2000
© 2000 Draeger Medical, Inc.

Installation of Exhaust Port Guard Block on Divan Ventilator

RETURN TO SERVICE PROCEDURE TABLE OF CONTENTS
RETURN TO CD-ROM TABLE OF CONTENTS

Installation of Exhaust Port Guard Block on Divan Ventilator

Installation Procedure

The guard block is designed to prevent external occlusion of the control pressure exhaust port on the underside of the Divan control module assembly. It is held in place by one screw and silicone adhesive.

1. Remove the existing M4 x 10 skt hd cap screw from its location near the exhaust port on the underside of the Divan control module.

2. Apply a thin film of silicone adhesive (P/N 1202537) to the flat surface of the guard block that will mate to the underside of the Divan control module.

3. Assemble the guard block and attaching hardware as shown in Figure 1, using the longer skt hd cap screw, lock washer and flat washer provided in the kit.

Attach the block to the Divan, making sure its edge is parallel to the edge of the bottom plate as shown in Figure 2.

DO NOT get any silicone adhesive on the exhaust port.

Verify that the guard block does not occlude the exhaust port.

Installation Procedure (continued)

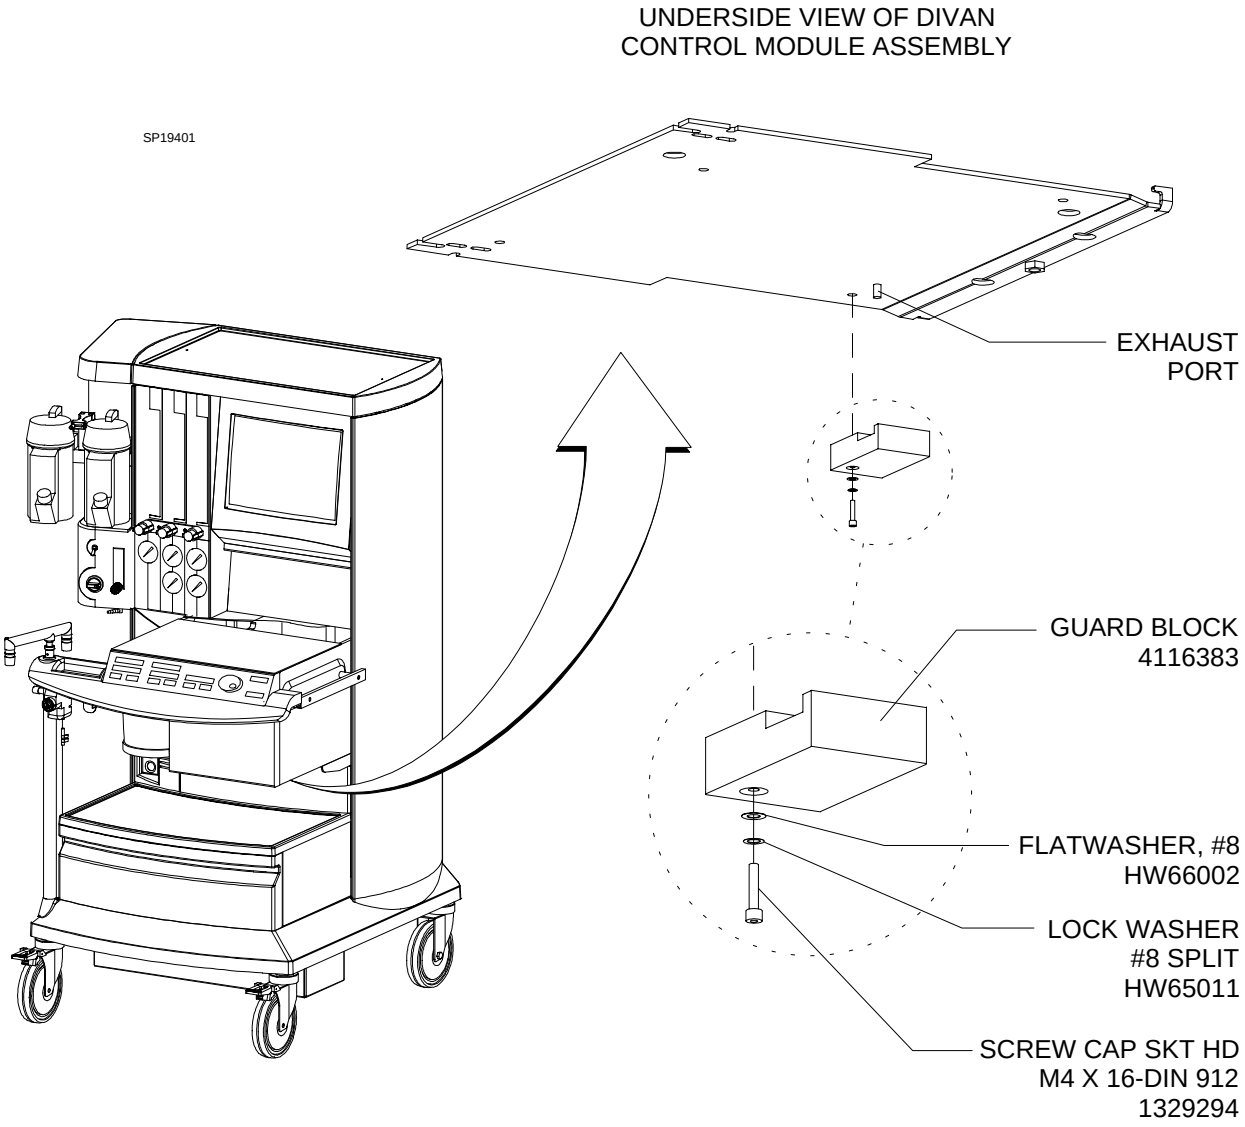

FIGURE 1. Guard Block Installation

Installation Procedure (continued)

BOTTOM VIEW: DIVAN CONTROL MODULE ASSEMBLY SP19402

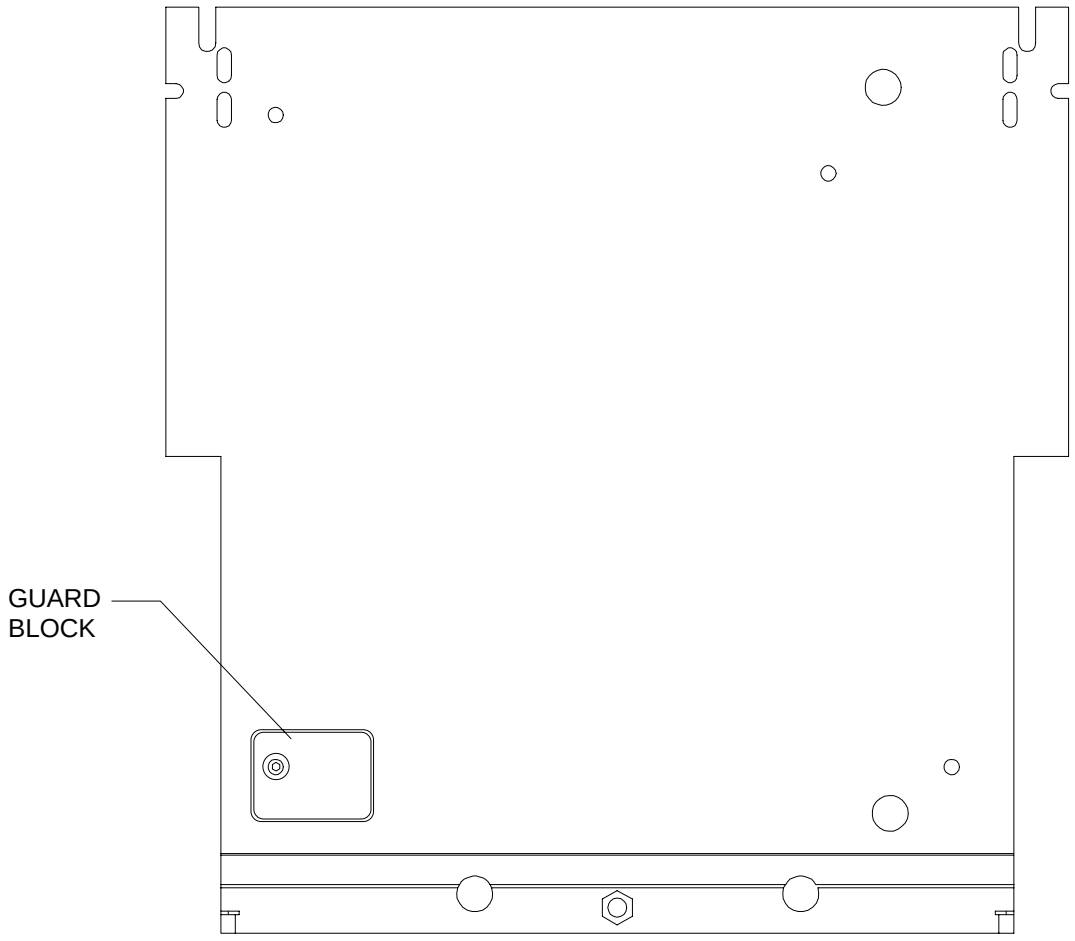

FIGURE 2. Guard Block Orientation

DrägerService®

Dräger

DrägerService
division of Draeger Medical, Inc.
3122 Commerce Drive
Telford, PA 18969
Tel: (215) 721-5402
(800) 543-5047
Fax: (215) 723-5935
Web: www.draegermedical.com
Printed in the U.S.A.